


608E

#### **CONTENTS:**

Pos	Name:	Art no:	Pcs
1	Sunvisor for Volvo FH/FM 4/5 och FMX	11-0001WV/CV	1
2	Mirror extender	411	1
3	Installation kit for sunvisor	90-0011	1
4	Carriage bolt M8x30	483	3
5	Washer 8,4x24x2 mm	471	3
6	Locknut M8	461	6

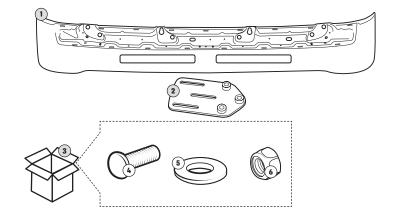

Pos	Name:	Art no:	Pcs
1	LED-bar Vision X	500/501	2
2	Y-cable	525	1
3	Installation kit for Vision X	90-0008	1
4	Bracket, left Vision X for Volvo	418	2
5	Bracket, right Vision X for Volvo	419	2
6	Hexagon screw M8x25 mm	451	4
7	Washer 8,4x24x2 mm	471	8
8	Rubber washer 8,5x30x3 mm	477	4
9	Locknut M8	461	4
10	Hexagon screw M8x20 mm	452	4
11	Spring washer M8	474	4
12	Washer 8,4x16x1,6 mm	472	4
13	Washer 10,5x20x2 mm	481	4
14	Nylon washer 10x20x2 mm	482	4

\*LED-bars and Y-cable only included with article number: 11-0001WV.

# IMPORTANT!

All installations should be done by experienced mechanics/vehicle electricians. In the event of your own modifications or making holes in the product, the warranty expires. Always follow the truck manufacturer's the truck manufacturer's bodywork instructions regarding drilling and wireing in the cab. The same applies to the dimensioning of cabling and the connection of lighting.

TruckStyle Sweden AB does not take responsibility for any da-mage that occurs in the event of an incorrect installation. The installation instructions describe the installation of sunvisor on a left-hand drive vehicle.

1. Start by removing the upper part (1) of the sunvisor by pushing in the upper part's lockings (2). Remove the outer covers (3).

NOTE! Save the upper part and the insulation behind the cover to be reused for the new sunvisor. Outer covers (3) will not be reused.

Upper part Locking 2.


0000

lο 0 Ó

5

3. Outer cover

1.

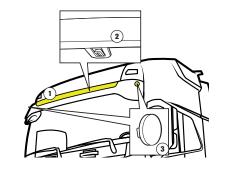

6

б 0 

3

à

0 0

Å

2. Remove the sunvisor from the cab by removing 10 flange screws (1) and washers (2).

> NOTE! Save flange screws, washers and underlying seals and spacers. Re-used when installing the new sun visor. Flange screws and flat washers at the two outer attachment points (3) are not reused.

- 1. Flange screw M8 2. Washer
- 3. Outer attachment point

0

1

60

Ø.-


6

ରେ



## Installation instruction for sunvisor with Vision X LED-bars

For Volvo FH/FM 4/5 and FMX

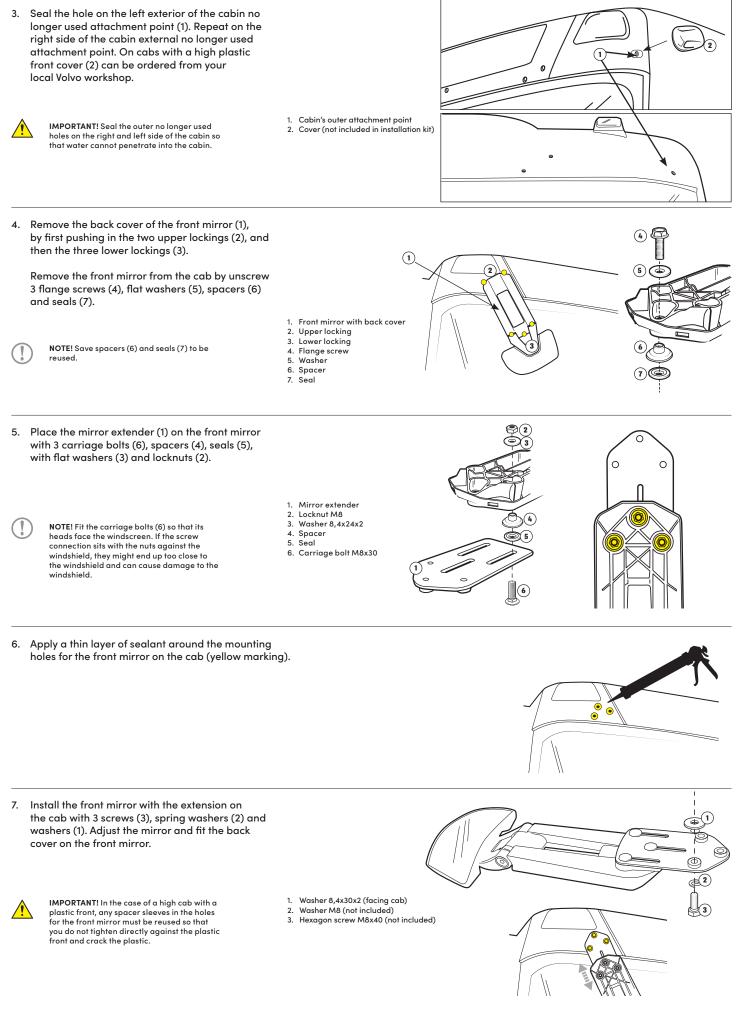


Art. nr: 608E - Installation instruction for sunvisor with Vision X LED-bars. Version 002



### Installation instruction for sunvisor with Vision X LED-bars

For Volvo FH/FM 4/5 and FMX

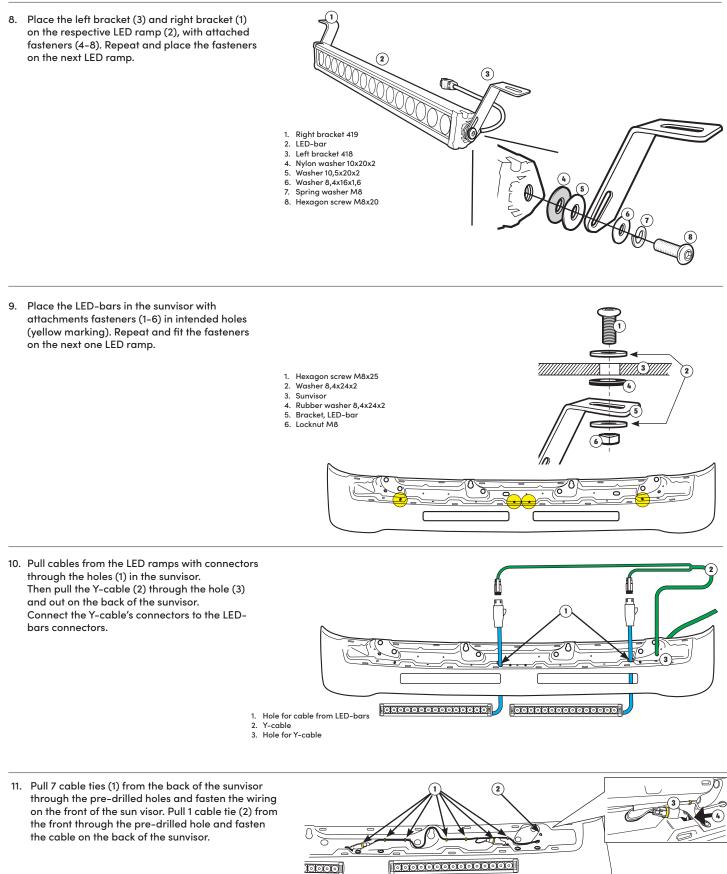



VIKTIGT! Attach the cable ties to the connectors as in the picture (3). So that they are centered in the holes (4).

#### 1. Cable tie

2. Cable tie


3. Connector from LED-bar with fitted cable tie

4. Hole



### Installation instruction for sunvisor with Vision X LED-bars

For Volvo FH/FM 4/5 and FMX

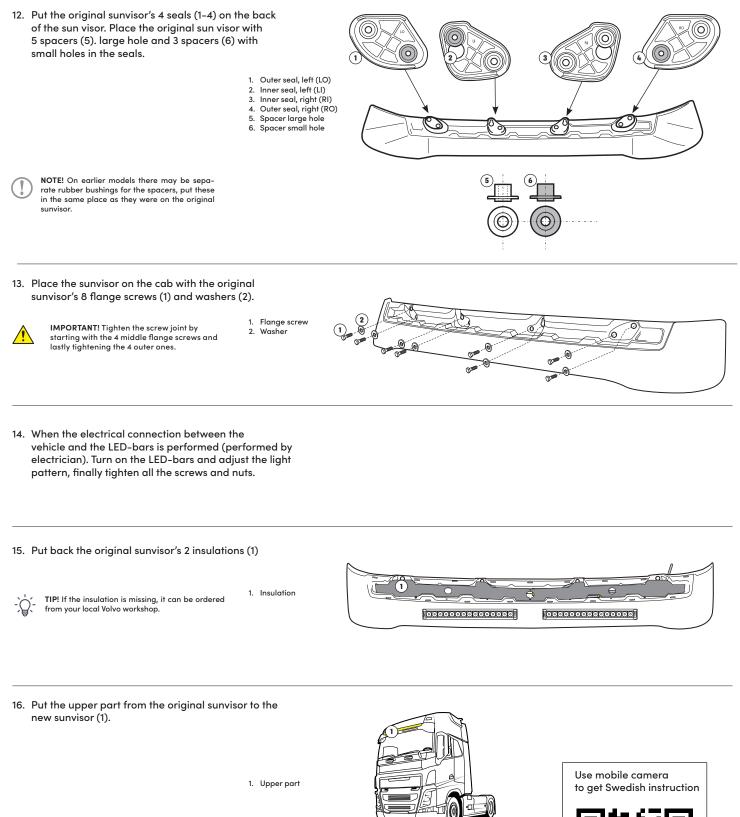



Swedish instruction: http://media.truckstylesweden.com/608



www.truckstylesweden.com order@truckstylesweden.com Phone: +46 (0)70-007 9876